EMBROIDERY LEAF TABLE RUNNER

Accessory of the Month April 2018

Embroidery Clothsetter



Click to download:

(1) <u>Embroidery design file</u>

(2) <u>Embroidery design template</u>



EMBROIDERY LEAF TABLE RUNNER

Accessory of the Month April 2018 Embroidery Clothsetter



Calibrate The Clothsetter:

- The first thing you need to do is calibrate your Janome clothsetter to work accurately with your Janome Embroidery machine.
- 2. Select the hoop you will be using for the embroidery and hoop with stabilizer, wadding and fabric.
- Locate the design on the embroidery machine that is built in and looks like a crosshair. (All our Janome Embroidery machines have this design in the built-in design section). Stitch this on your Janome embroidery machine. | Figure A
- 4. Remove the hoop from the machine and attach the hoop to your Janome clothsetter. Now take your screwdriver and loosen the screws which hold the metal plate in place (where you attach the hoop).
- 5. Lower the Janome Clothsetter arm so that it rests lightly on top of the embroidery in the hoop. Shift the hoop a little until the red Clothsetter arm marking is exactly above/in line with the cross hair stitching in the hoop. Tighten the screws taking care not to change the position of the hoop in any way. | Figure B
- 6. The Clothsetter is now calibrated for your machine and when fabric is hooped using the Clothsetter it should be accurately lined up in the center of the embroidery hoop at the machine as well.

Requirements

•(2) - 1.5m x 14'' wide - cotton fabric

.

- Wadding or fusible pellon to fit the back of the fabric
- •Tear away to fit hoopings
- Matching sewing thread for construction
- Embroidery thread to use for leaves
- Empty bobbins and bobbin fil bobbins
- Quilting clips / Pins
- Fabric Marker
- Ruler
- Scissors
- •Standard Sewing Foot
- •1/4'' foot (O)
- Tape measure
- Iron and Ironing Board
- Tweezers
- Janome Clothsetter
- •Embroidery machine
- Hoop to fit design (138mm x 190mm)



Clothsetter

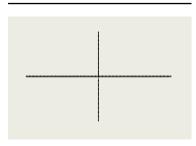


Figure A.



Figure B.



EMBROIDERY LEAF TABLE RUNNER

Accessory of the Month April 2018 Embroidery Clothsetter

Start the table runner embroidery:

- 10. Mark the length of the table runner fabric at the centre of the width using a fabric marker. This will be 7'' in if using 14'' wide strip.
- Mark the centre of the length in the opposite direction and then mark 5 ¼'' markings to the left and right of the centre all the way to each end. (This should be 11 markings)
- 12. Print a template of the design.
- 13. Punch 5 holes in the template exactly on the crosshair/clothsetter marking. (One in the center and one on each of the arms of the crosshair.)
- 14. Mark a dot with a wash away fabric marker through all 5 holes onto the grid markings made along the length of the runner fabric. Be very sure to mark an arrow as per the clothsetter marking on the template. This arrow always points to the top of the hoop and you will need this to be sure to hoop up the fabric in the correct orientation.
- 15. Repeat for all the hoopings to embroider down the length of the fabric.
- Now hoop up the fabric in the applicable embroidery hoop by attaching just the outer hoop to the Janome Clothsetter.
- 17. Lay the fabric over the hoop and lower the Clothsetter arm. Line up the Red Clothsetter marking with the fabric marking. | Figure C.
- Insert the inner hoop and tighten in place being sure to keep the 2 cross markings lined up.
- 19. Remove the hoop from the Clothsetter and attach to the Embroidery unit of your Janome Embroidery machine.
- 20. Transfer the design to the machine via USB or method preferred for your machine.
- 21. Stitch out the embroidery design.
- 22. Unhoop the fabric and repeat the process for each design using the clothsetter each time to line up the crosshair with the markings to allow for each additional design to be spaced evenly. | Figure D
- 23. Once complete remove the stabilizer and iron the finished embroidery.
- 24. Square the fabric and wadding to create the finished size of the runner.
- 25. Lay the backing of the runner onto the front. Sew around all four sides leaving a 3'' opening on one of the long sides.
- 26. Turn through and press.
- 27. Slip stitch the opening closed and your runner is complete.

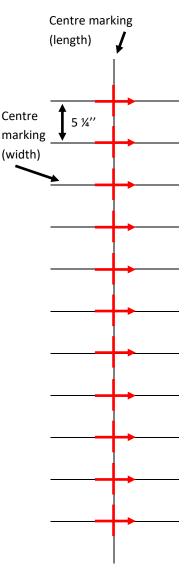




Figure C



Figure D

JANOME JA 0418